


# TIGE À CHAPE À SERTIR

Acier : S355J2

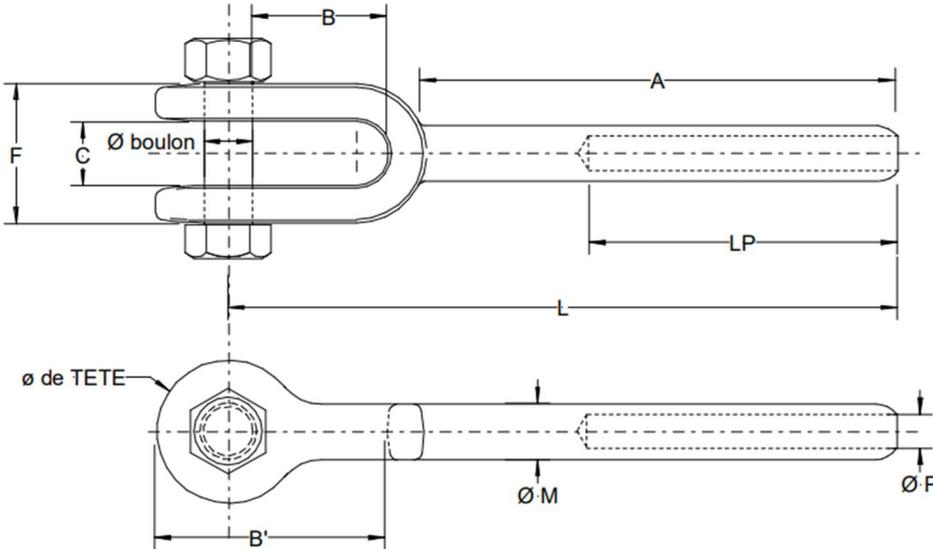

Pour Cable de	Tige Ø M	A	B	C	F	Ø TETE	Ø Boulon	L	Ø P	LP	CMU	CR mini	PU en Kg
5	10	72	26.5	12	26	18	8	111	6	50	0T625	2T5	0.160
6	12	95	32	14	31	23	10	136	7	50	0T825	3T3	0.205
7	12	95	32	14	31	23	10	136	8	50	0T825	3T3	0.200
8	14	120	34	16	35	25	12	169	9	65	1T3	5T2	0.270
9	16	135	38	20	40	30	14	190	10	70	1T5	6T	0.480
10	20	160	52	25	50	37	16	231	11	80	2T5	10T	0.770
11	20	160	52	25	50	37	16	231	12	90	2T5	10T	0.770
12	24	175	57.5	30	61	43	20	253	13	95	3T75	15T	1.300
13	24	175	57.5	30	61	43	20	253	14	100	3T5	14T	1.300
14	24	175	57.5	30	61	43	20	253	15	100	3T25	13T	1.280
16	27	185	61	30	60	48	22	271	17	115	4T	16T	1.940
18	30	195	76.5	35	69	55	24	302	19	135	5T	20T	2.330
20	30	195	76.5	35	69	55	24	302	21	140	4T25	17T	2.300
22	35	235	79	38	80	65	27	347	23	160	6T5	26T	3.730
26	40	260	98.5	46	100	77	36	395	27	180	8T	32T	6.100

Codification articles R. Rose

<u>Tige à chape à sertir</u>	CHAS
Finition	G – Galva N- Noir
Calibre Tige	Ø M
Ø câble	Pour câble de

Ex : Tige à chape à sertir galva de 20 pour câble de 10 = CHASG20/10